MODEL 3255 Accelerometer

PC Board Mountable Accelerometer 0.5 to 4.5 VDC Output Integral Temperature Compensated 10,000g Over-Range Protection

DESCRIPTION

The Model 3255 is a two-chip accelerometer designed for surface mount applications. The package can be mounted in one of two orientations, allowing the measurement axis to be either parallel or perpendicular to the mounting surface without the use of costly brackets. This accelerometer consists of a micro machined silicon mass suspended by multiple beams from a silicon frame. Piezoresistors located in the beams change their resistance as the motion of the suspended mass changes the strain in the beams. Silicon caps on the top and bottom of the device are added to provide over-range stops. This design provides for a very low profile, high shock resistance, durability and built-in damping

FEATURES

- Surface Mount Package
- Three Axis Mounting Options
- Self Test Function
- DC Response
- Gas Damping
- Built-in Overrange Stops

APPLICATIONS


- Impact Testing
- Vibration/Shock Monitoring
- Crash Applications
- Aerospace Testing



北京赛斯维测控技术有限公司 北京市朝阳区望京西路48号 金隅国际C座1002 电话: + 86 010 8477 5646 传真: + 86 010 5894 9029 邮箱: <u>sales@sensorway.cn</u> http://www.sensorway.cn over a wide usable bandwidth. A patented self-test feature is also built into the sensor. By applying a voltage to the self-test pin, an electrostatic force is created that attracts the seismic mass towards the top cap, simulating an acceleration and allowing proper sensor function to be verified.

standard ranges					
Range	g				
±25	•				
±50	•				
±100	•				
±250	•				
±500	•				

dimensions

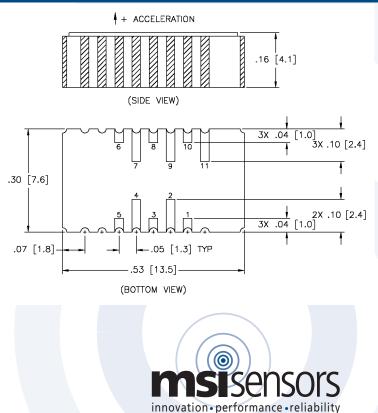

www.sensorway.cn

Model 3255 Accelerometer

performance specifications

Supply Voltage: 5.0 VDC

Ambient Temperature: 25°C (Unless otherwise specified)

MSI Sensors reserves the right to update and change these specifications without notice.

		RANGE					
PARAMETERS	±25G	±50G	±100G	UNITS	NOTES		
Bandwidth(MIN)	0-2000	0-2000	0-2000	Hz	8		
Sensitivity (MIN/MAX)	76.0/84.0	38.0/42.0	19.0/21.0	mV/g	1,4		
		RANGE					
PARAMETERS	±250G		±500G	UNITS	NOTES		
Bandwidth(MIN)	0-3000		0-3000	Hz	8		
Sensitivity (MIN/MAX)	7.6/8.4		3.8/4.2	mV/g	1,4		
ALL RANGES							
PARAMETERS	MIN	ТҮР	MAX	UNITS	NOTES		
Zero Acceleration Output	2.3	2.5	2.7	Volts	1,4		
Non-linearity		0.2	1.0	±%Span	2		
Transverse Sensitivity		1	3	±%Span			
Supply Voltage	4.5	5.0	7.0	Volts	3		
Supply Current			10	mA			
Self-Test Input Voltage	-30		0	Volts	6, 7		
Self-Test Response (Vst = -5V)	-0.89	-1.48	-2.07	G	6, 7		
Self-Test Input Current (Vst = -5V)			0.1	mA	6, 7		
Self-Test Accuracy	-5		5	%	4, 6, 7		
Output Source Current (load to ground)	1.0			mA			
Output Sink Current (supply to load)	0.5			mA			
Shock Limits			10,000	G			
Compensated Temperature	-20°C to +85°C Contact factory for custom temperature compensation						
Operating Temperature	-40°C to +125°C						
Weight	1.5 Grams						

Notes

1. The output voltage increases from the Zero Acceleration Output for positive acceleration and decreases for negative acceleration.

2. Best Fit Straight Line.

3. Output is ratio metric with supply voltage in the range of (5.0 \pm 0.5) V.

4. Includes effects over operating temperature range.

5. 1 Hz to 10 kHz.

6. Applying the self-test input voltage simulates an acceleration. The sensor output is proportional to the square of the voltage difference between the self-test input and the positive supply. When not using the self-test function, the self-test input pin should be connected to the positive supply voltage. For detailed description refer to Technical Note TN010. 7. Self-test input voltage is with respect to supply voltage. For example, if supply voltage is 5 VDC then Vst = -5 V is equivalent to ground. 8. The useful frequency range is defined as the range of frequencies over which the device sensitivity is within $\pm 5\%$ of the DC value. 9. The alarm output is a digital output which is 0 V during normal operation and 5 V when the output voltage of the accelerometer die is outside the normal range. This is the case if there is a malfunction of the accelerometer or a broken wire bond to the sensor.

ordering information			electrical schematic		
2255 050			Pad	Function	
			1	Alarm Function	
			2	Signal Output	
Acceleration Range Model			3	Ground	
Model			4	+5V Supply	
			5	Self Test	
MSI Sensors 1000 Lucas Way Hampton, VA 23666 USA www.msisensors.com	Vibration Sensors Technical Support: Tel: 1- 949-716-5377 Fax: 1- 949-916-5677		6 thru 11	No Electrical Connection	

Customer Service: Tel: 1-757-766-1500 (Toll Free: 1-800-745-8008) Fax: 1-757-766-4297

Email: vibration@msisensors.com